

DATE OF BULLETIN:

10-17-2017

THIS BULLETIN SUPERSEDED BULLETIN(S):

None

MODELS AFFECTED:

PILOT-HD GTX XR

Retired Models:

PILOT

MACHINE SYMPTOMS:

Shroud Wipers moving out of adjustment over time

SCOPE OF BULLETIN:

Spring underneath Shroud Adjustment Knob

Rubber Washer on top of Shroud Adjustment Knob


MATERIALS REQUIRED:

Support Spring Part #: 4-386

Rubber Washer #: H-4440040

REVISIONS:

All Disk Rider Scrubbers include new Rubber Washer (Part #: H-4440040) and Support Spring (Part #: 4-386) surrounding the Shroud Adjustment Knob. The Spring that is supported by the Deck, ensures that the Adjustment Knob will not self adjust down over time from machine usage. The Rubber Washer that now sits on top of the Adjustment Knob is to reduce rattle with the machine in operation.

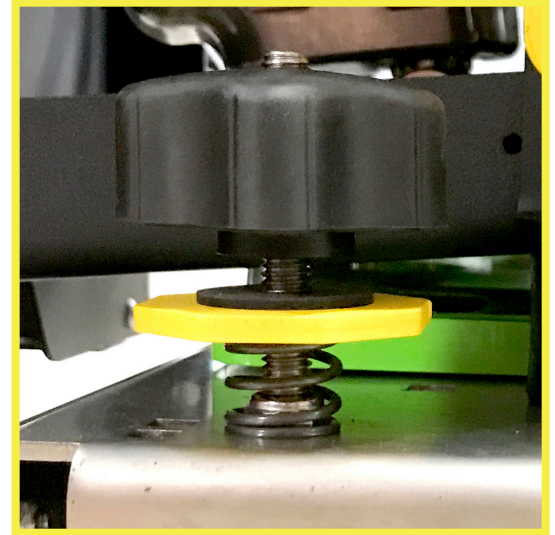

Spring Under Shroud Adjustment Knob



Rubber Washer On Top Of Shroud Adjustment Knob

