PCB-638

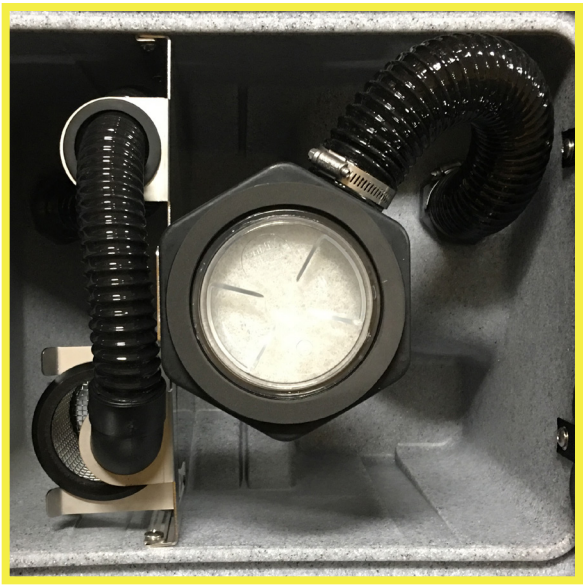

DATE OF BULLETIN:
5-31-2017

THIS BULLETIN SUPERSEDED BULLETIN(S):
None

MODELS AFFECTED:
RECON
MICROMINI

MACHINE SYMPTOMS:
None

SCOPE OF BULLETIN:
New Stainless Steel Baffle standard
New drop-in Float-ball screen and enlarged Float-ball
New white Vacuum Filter
Retractable front fill-hose

MATERIALS REQUIRED:
RECON Tank #: 150-4140W
MICROMINI Tank #: 164-4140W

REVISIONS:

1. New Stainless Steel Baffle standard to reduce potential oxidation or corrosion. New squeegee intake hose won't back fill.

Corroded Old Powder-Coated

New Stainless Steel

2. New Drop-In Float-Ball Screen to prevent assembly from dropping into tank assembly and enlarged Float-Ball to prevent the potential soap foam from getting into the Vacuum Motor. Enlarged 2" vacuum intake hose for better airflow.

Old Clip-On Float Ball

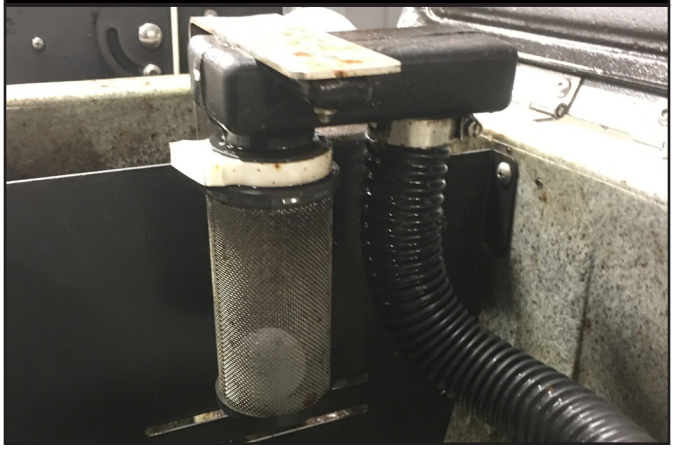

New Drop-In Float Ball

3. New white Vacuum Filter as an added layer to prevent potential soap foam or small particulates into the Vacuum Motor.

Dirty Filter

Clean New Filter

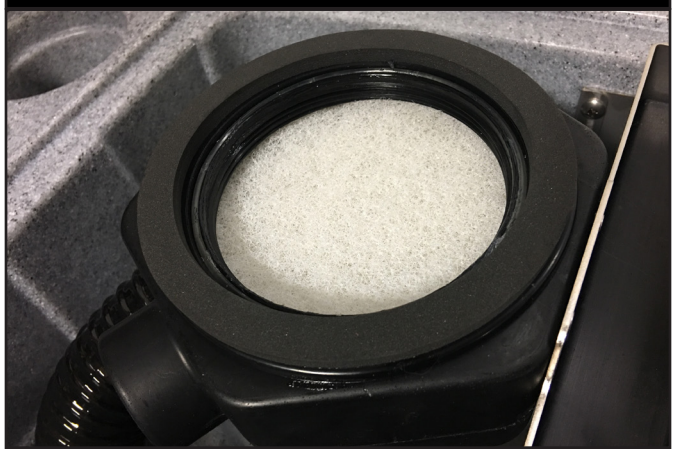

4. Retractable front fill-hose for easy filling from standard sinks and removable screen.

Old Hose

New Fill-Hose