

Product Change Bulletin

Upgrade of Casters

Date Of Bulletin:

04-01-2009

This Bulletin Superseded Bulletin(s):

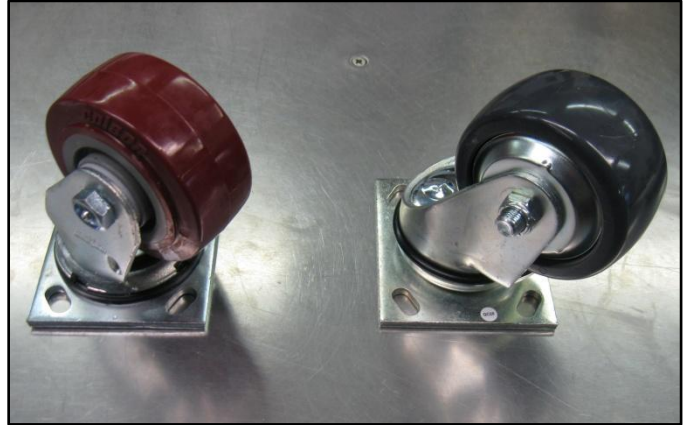
None

Models Affected:

MiniMag, Magnum

Machine Symptoms:

Strings or other thin long strands getting caught in caster, grease leaking, hard to turn machine.

**Scope of Bulletin:**

We have upgraded the casters used on the MiniMag and Magnum scrubbers. The new casters now come with a stronger rubber seal to keep grease in, and also dust caps to prevent debris from getting into the bearings effecting performance and longevity. These provide easier steering and less rolling resistance fro pad assist machines.

Materials Required:

170-3030

½" wrench

½" socket

Inspection:

Check to see if the casters on machine have a red wheel.

Correction:

To install new casters prop machine up onto a wooden block or something that will support the weight of the machine and will fit under the chassis. Remove the 5/16" bolts holding the caster on. Replace the old caster (190-3035) with the new caster (170-3030).